



Release Notes for the Cisco ASA Device Package Software, Version 1.2(10) for ACI

Revised: March 2, 2018,

Release Notes for the Cisco ASA Device Package for ACI

Download the Software

Use your Cisco.com login credentials to obtain the Cisco ASA Device Package software image from:

<https://software.cisco.com/download/release.html?mdfid=283123066&flowid=22661&softwareid=286279676>

Available APIC Products

Starting with release 1.2(7.8), there are two versions of the Cisco ASA Device Package software for ACI:

- Cisco ASA Device Package software for ACI. This version allows you to configure many important features of the ASA from the APIC, including (but not limited to) the following:
 - Interface
 - Routing
 - Access-list
 - NAT
 - TrustSec
 - Application inspection
 - NetFlow
 - High availability
 - Site-to-site VPN
- Cisco ASA Device Package Fabric Insertion software for ACI. This version contains the following subset of features of the original version:
 - Interface
 - Dynamic routing
 - Static routing

Supported Versions

Cisco ASA Device Package software supports only the version of APIC that it is shipped with.

The following table lists the supported versions of the Cisco ASA software for each of the supported platforms.

Platform	Software Version
Cisco ASA 5500-X (5512 through 5555)	ASA 8.4(x) and newer
Cisco ASA 5585-X (SSP 10 through SSP 60)	
Cisco Firepower 9300 Security Appliance	ASA 9.6(1) and newer
Cisco Firepower 41xx Security Appliance	
Cisco Firepower 21xx Security Appliance	ASA 9.8(1) and newer
Cisco ASAv	ASA 9.2(x) and newer (Cisco ASA and APIC Compatibility Matrix)

Install the Software

To upgrade from an older to a newer version, you do not need to remove the previous software package if your APIC release has the fix for CSCuv4353. Otherwise, remove the older version from the APIC before installing the newer version.

Sign in on Cisco.com to download and install the device package software. For instructions, see the respective version of the Cisco ASA Quick Start Guide for APIC Integration linked on the Download Software page.

Bug Search

As a registered Cisco.com user, sign in to view more information about each bug or caveat using the [Cisco Bug Search Tool](#).

Resolved Enhancement Requests in Version 1.2(10)

Table 1: Enhancement Requests Resolved in the Cisco ASA Device Package - Policy Orchestration with Fabric Insertion, Version 1.2(10)

Request/Caveat	Description
CSCvf71790	Support Message of the Day (MOTD).
CSCvf71796	Support SNMP configuration.
CSCvf71799	Support interface description configuration.

Table 2: Enhancement Requests Resolved in the Cisco ASA Device Package - Fabric Insertion, Version 1.2(10)

Request/Caveat	Description
CSCvb90258	ASA FI device package restore out-of-band config feature enhancement.

Resolved Caveats in Version 1.2(10)

Table 3: Caveats Resolved in the Cisco ASA Device Package, Version 1.2(10)

Caveat	Description
CSCvd41556	ASA ACI device package needs support for IRB feature(s).
CSCvg02243	Leading or trailing whitespace characters in high or low port causes traceback.
CSCvg23655	Modified snips via SVCpol do not get pushed to the ASA firewall.
CSCvg34885	Error extracting ASA FI device package during config import.
CSCvg41801	Should allow prefix-length in place of netmask for StaticRoute.
CSCvg72800	Validation required for validating IPv6 subnet mask while deploying service graph.

Important Notes

- The ASA version does not support multiple context mode.
- ACE with dynamic EPG requires ASA image 9.3.2 or newer.

Policy Manager Locks Up When the Configuration for BGP Peering for the Service Appliance is Incomplete

Use this workaround for caveat CSCuw0342:

Symptom: The Policy Manager crashes when the l3Out that is used for BGP peering for the service appliance has an incomplete configuration (CSCuw03425).

Conditions: The l3Out used for BGP peering for the service appliance is missing l3extRsNodeL3OutAtt.

Workaround: Make sure that the l3Out contains l3extRsNodeL3OutAtt. This problem will be fixed in a subsequent release.

The following shows the BGP XML example with l3extRsNodeL3OutAtt:

```
<polUni>
<fvTenant name="tenant1">
<l3extOut name="StaticExternal">
<l3extLNodeP name="bLeaf-101">
<l3extRsNodeL3OutAtt tDn="topology/pod-1/node-101" rtrId="190.0.0.11">
<ipRouteP ip="50.50.50.0/24">
<ipNexthopP nhAddr="40.40.40.102/32"/>
</ipRouteP>
</l3extRsNodeL3OutAtt>
<l3extLIIfP name="portIf">
<l3extRsPathL3OutAtt tDn="topology/pod-1/paths-101/pathep-[eth1/15]" ifInstT="ext-svi" encap="vlan-3843"
addr="40.40.40.100/28" mtu="1500"/>
</l3extLIIfP>
</l3extLNodeP>
<l3extInstP name="ExtInstP">
<l3extSubnet ip="50.50.50.0/24" scope="export-rtctrl"/>
</l3extInstP>
<l3extRsEctx tnFvCtxName="tenant1ctx1"/>
</l3extOut>
</fvTenant>
</polUni>
```

Manually Re-Sync the APIC if You Changed the Version of ASA After It Was Registered with the APIC

Use this workaround for caveat CSCva89163:

Symptom: Some commands don't work. For example, the information for the **network** and **neighbor** commands is not displayed (CSCva89163).

Conditions: If you're using a version of the ASA that is different from the version that is registered with the APIC, it doesn't automatically re-register with the APIC. Therefore, if you're using an older version of ASA, some commands may not be supported.

Workaround: Manually re-sync the APIC with the ASA by completing the following procedure:

Procedure

-
- Step 1** On the **Tenants** tab of the APIC GUI, expand **L4-L7 Services** in the left pane.
 - Step 2** Expand **L4-L7 Devices**.
 - Step 3** Expand the firewall that is running the APIC.
 - Step 4** Right-click the device that is running the APIC, and select **Re-Query for Device Validation**.
-

ASA Configuration Not Rolled Back on Changing Concrete Interfaces

Use this workaround for caveat CSCvd65130:

Symptom: When cluster interfaces are changed under lif configuration for a deployed graph in bridge mode, the new interface might not get updated correctly on the ASA.

Conditions: When changes are made to the ASA device cluster interface configuration.

Workaround: Detach the graph from the contract before making any device changes and then attach it.

Second Graph Pushes Incorrect Configuration to ASA in Bridged Mode

Use this workaround for caveat CSCvd68860:

Symptom: When a second or subsequent graph is deployed on a new set of cluster interfaces in an ASA in bridged mode, the user might see cluster interfaces not configured under the correct bridge-group. This results in a configuration issue which creates a conflict with existing cluster interfaces using the default names in the ASA.

Conditions: Graph deployment using a new set of cluster interfaces with default interface names in an ASA in bridged mode.

Workaround: Rename the cluster interface name under **Interface Related Configuration** in graph parameters while configuring the graph.

Restore Out-of-Band Configuration

Use this enhancement feature for caveat CSCvb90258:

Symptom: The ASA Fabric Insertion (FI) Device Package (DP) does not support saving configuration out-of-band.

Conditions: The ASA-FI-DP only supports routing and interface configuration. It does not support the configuration of security policy binding commands, such as `access-group` and `nat`, to the service graph. To assign a security policy to a service graph, you must manually configure the setup. In the case of re-rendering a service graph after removing it, you must manually reconfigure the bindings.

Solution: This enhancement feature enables you to save the security policy binding commands to a file, which the ASA-FI-DP can apply after the service graph is reattached.

XML: A folder named `SecurityPolicyAssignment` has been added under `vnsMFunc` which enables you to enter a name for the configuration that has the security policy to assign to the service graph.

```
<vnsMFunc name="Firewall">
<vnsMFolder key="ExIntfConfigRelFolder" dispLabel="External Interface Configuration"
description="A list of additional interface parameters for external connector"...>
<vnsMFolder key="InIntfConfigRelFolder" dispLabel="Internal Interface Configuration"
description="A list of additional interface parameters for internal connector" ...>
<vnsMConn name="external" ...>
<vnsMConn name="internal" ...>
  <vnsMFolder key="SecurityPolicyAssignment"
    dispLabel="Security Policy Assignment"
    description="Assign the security policy in the named file to the service-graph">
    <vnsMParam key="ConfigFile"
      dispLabel="Configuration File"
      dType="str"
      description="Specify the name of the file that contains the out of band configuration specific to the
service-graph"/>
  </vnsMFolder>
</vnsMFunc>
```

APIC:

Edit L4-L7 Service Parameters



Click row to edit value

Contract Name: dahai
Graph Name: dahai
Node Name: N1

Features

Basic Parameters **All Parameters**

All

Folder/Param	Name	Value
Device Config	Device	
Bridge Group Interface		
Interface Related Configuration	externalIf	
Interface Related Configuration	internalIf	
Function Config	Function	
External Interface Configuration	ExtConfig	
Internal Interface Configuration	IntConfig	
Security Policy Assignment		
Configuration File	ConfigFile	my-service-graph.cfg

Update Reset Cancel

Show Usage Cancel Submit

- If the file is on the ASA, enter the name of the file.
- If the file is on a TFTP server, enter: `tftp://<ip-address>/<filename>`
- If the file is on an FTP server, enter: `ftp://<ip-address>/<filename>`

The contents of the file should be commands that you must enter out-of-band that reference the interfaces used in the service graph. For example:

```
access-group <acl-name> [in|out] interface <nameif>
nat (<nameif>, <nameif>) ...
service-policy <policy-name> interface <nameif>
crypto map <map-name> interface <nameif>
crypto ike2 enable <nameif>
```

Here's an example of such a file for a service graph with interfaces `externalInt` and `internalInt`:

```
access-group access-group external_access_acl in interface externalInt
nat (internalInt,externalInt) source static real_obj mapped_obj
nat (internalInt,externalInt) source dynamic any mapped_obj interface
```

Commands that do not reference an interface should not be part of the file because they're not removed when you remove the service graph. Examples of such commands include:

```
access-list
object network
object service
object-group network
object-group service
```

Related Documentation

- [Cisco ASA Series Roadmap](#)
- [Cisco Application Policy Infrastructure Controller \(APIC\) Product Support](#)
- [Cisco Application Centric Infrastructure \(ACI\) Security Solution](#)



Americas Headquarters
Cisco Systems, Inc.
San Jose, CA 95134-1706
USA

Asia Pacific Headquarters
Cisco Systems (USA) Pte. Ltd.
Singapore

Europe Headquarters
Cisco Systems International BV
Amsterdam, The Netherlands

Cisco has more than 200 offices worldwide. Addresses, phone numbers, and fax numbers are listed on the Cisco Website at www.cisco.com/go/offices.