

WAP371 يف تباثلل جماربلا ةيقرت

فدهلا

ءاطخألا حالصا اضيا اهنك مي و ةمدقت م تازيم ةديدجلا ةتباثلل جماربلا تارادصا نمضتت ةكبشلا زاهج اءا نيسحت نكمي . ةكبشلا ةزهجا ىلع اقباس ةدوجوم تناك يتي لال خ نم ةتباثلل جماربلا ةيقرت تاي لمع اءرج نكمي . ةتباثلل جماربلا ثءجا ما دختساب مءاخ نم فلملا لي زنت م تيس ، TFTP لي مء ما دختسا دنع . HTTP/HTTPS و TFTP لي مء فلم لي زنت ب WAP موقيس ، HTTP/HTTPS لي مء ما دختسا دنع . ةكبشلا ىلع TFTP ب . بول ضرعتسم لال خ نم كب صاخلا رتوي بمكلا نم ةرشابم ثي دحتلا

لوصول طاقنل تباثلل جماربلا ةيقرت ةيفيك حرش وه دنتمس م اءه نم فدهلا TFTP مءاخ و HTTP/HTTPS لي مء لال خ نم WAP371 و WAP571 .

قيبطتلل ةلباقلا ةزهجالا

- WAP371
- WAP571

جماربلا لي زنتل URL ناوئع

[WAP371](#)

[WAP571](#)

ةتباثلل جماربلا ةيقرت

ءراد > ةراد رتخاو بول ةئيهتل ةءاسملا ةءالا ىل لوخدلا لي جستب مق 1 . ةوطخلا ةتباثلل جماربلا ةراد ةحفص حتف متي . ةتباثلل جماربلا

Manage Firmware

PID VID: WAP371-A-K9 V01

Active Firmware Version: 1.0.0.10

Inactive Firmware Version: 1.0.0.10 [Swap Active Image](#)

Transfer Method: HTTP/HTTPS TFTP

Source File Name: No file selected.

Note: Uploading the new software may take several minutes. Please do not refresh the page or navigate to another page while uploading the new software, or the software upload will be aborted. When the process is complete the access point will restart and resume normal operation.

زاهجالا لوح ةلصللا تا ذتامولعمل ةحفصلا ىلع رهظي .

- لوصول ةطقنل دروملا فرعم و جتتملا فرعم — PID VID ضرعي .
- يلحال طشنل تباثلل جماربلا رادصا ضرعي — طشنل تباثلل جماربلا رادصا .
- طشنل ريغ تباثلل جماربلا رادصا ضرعي — طشنل ريغ تباثلل جماربلا رادصا . يلحال

لقح يف ةبولطملا تباثلا جمانربلا لقن ةقيرطب صاخلا رايخلا رز قوف رقنا 2. ةوطخلا لقنلا ةقيرط.

Manage Firmware

PID VID: WAP371-A-K9 V01

Active Firmware Version: 1.0.0.10

Inactive Firmware Version: 1.0.0.10 [Swap Active Image](#)

Transfer Method: HTTP/HTTPS TFTP

Source File Name: No file selected.

Note: Uploading the new software may take several minutes. Please do not refresh the page or navigate to another page while uploading the new software, or the software upload will be aborted. When the process is complete the access point will restart and resume normal operation.

[Upgrade](#)

ييلاتلا وحنلا ىلع ةحاتملا تاراخلا ديحت متي:

- HTTP/HTTPS — ةتباثلا جماربلا فلم لقنل بيولا ضرعتسم مدختسي — مسقلل [ةتباثلا جماربلا ةيقرت](#) ىلا عجرا، ةتباثلا جماربلا ةيقرت نم عونلا اذه [HTTP/HTTPS مادختساب](#).
- TFTP — ووصول WAP زاوجل (TFTP) طسبملا تافلما لقن لوكوتورب مداخل بلطتي — مداخلتسال. مداخل اذه ىلع دوجوملا فلملا نم تباثلا جمانرب ةيقرتب WAP موقوي. هيللا، عئاش TFTP مداخل ليذنت نكمي. رتويبمكلا ىلع TFTP مداخل ليذنت بجي، ةقيرطلا هذه مداخل ىلع لوصول ةطقنل تباث جمانرب ثدحاً ظفح نم دكأت. [ان.ه](#)، TFTPd32 و TFTPd64 [جماربلا ةيقرت](#) ىلا عجرا، ةتباثلا جماربلا ةيقرت نم عونلا اذه ىلع لوصول TFTP. [TFTP مادختساب](#) مسقلل [ةتباثلا](#).

[HTTP/HTTPS مادختساب ةتباثلا جماربلا ةيقرت](#)

اقباس هلبيذنت مت يذلا ةروصولا فلم حتفل ضارعتسا ىلع رقنا 1. ةوطخلا

Manage Firmware

PID VID: WAP371-A-K9 V01

Active Firmware Version: 1.0.0.10

Inactive Firmware Version: 1.0.0.10 [Swap Active Image](#)

Transfer Method: HTTP/HTTPS TFTP

Source File Name: No file selected.

Note: Uploading the new software may take several minutes. Please do not refresh the page or navigate to another page while uploading the new software, or the software upload will be aborted. When the process is complete the access point will restart and resume normal operation.

[Upgrade](#)

عاوناً لمعت ال .tar. فلم رفوتملا ةتباثلا جماربلا ةيقرت فلم نوكي نأ بجي: **ةظحالم** تافلما تاقيسنت نم ىرخأ.

ةيقرتلا ةيلمع ءدبل ةيقرت قوف رقنا 2. ةوطخلا.

Manage Firmware

PID VID: WAP371-A-K9 V01

Active Firmware Version: 1.0.0.10

Inactive Firmware Version: 1.0.0.10


Transfer Method: HTTP/HTTPS
 TFTP

Source File Name: WAP371_1.0.1.5.tar

Note: Uploading the new software may take several minutes. Please do not refresh the page or navigate to another page while uploading the new software, or the software upload will be aborted. When the process is complete the access point will restart and resume normal operation.

ةعبات ملل "قفاوم قوف رقنا .ديكأت ةذفان رهظت 3. ةوطخلل

Confirm

 The AP software will now be upgraded. This process may take several minutes. The AP will be unavailable while the upgrade is taking place. Do not power down the access point while the upgrade is in process. When the upgrade is complete the access point will restart and resume normal operation. The configuration will be retained and applied after the upgrade.

مدقتل دي قةيقرتل ةحفص رهظت:

Manage Firmware

The new software has been successfully uploaded to the AP.


The AP will now save the new software, load it, reboot and come up with the last saved configuration.

The AP will be unavailable while the upgrade is taking place. Do not power down the access point while the upgrade is in process.

This process will take approximately 6 minutes.

Upon completion, the AP will re-boot and the Logon page will be displayed so that you can re-login.

If the IP address of the AP has changed, you will need to access the Logon page manually at its new IP address.

Please wait, upgrade in progress: 

ةي لم عمل لم تكت يتح ثي دحتل مدع اءرل .قئاق د عضب ةيقرتل قرغتست :ةطءالم
 دق .ةي دءال ةي لم عمل فنأتست و دي هم تل لوصول ةطقن دي عت ،ةي لم عمل مامت اءرجم بو
 زاءال ةيقرت ءانثأ تقؤم لكشب لاصلتال رايتلاب ني لصلت مل ءال عمل ءي مء دق في
 رهظت مل اءا .ةيقرتل لامتكا دعب اي ودي ءحفصلل ثي دحتل لءا ءاتحتس ،ةني عم تالء في
 ب.وي وضرعتسم ثي دحتب مقف ،قئاق د 6 دعب لوءدل لءي ءست ءحفص

[TFTP مءءختساب ءتءاثلل ءماربلل ةيقرت](#)

رءصم لءل مءل لءق في ءتءاثلل ءماربلل فلم مءل لءا .1 ةوطخلل

Manage Firmware

PID VID: WAP371-A-K9 V01

Active Firmware Version: 1.0.0.10

Inactive Firmware Version: 1.0.1.5 [Swap Active Image](#)

Transfer Method: HTTP/HTTPS
 TFTP

Source File Name: (Range: 1 - 128 Characters)

TFTP Server IPv4 Address: (xxx.xxx.xxx.xxx)

Note: Uploading the new software may take several minutes. Please do not refresh the page or navigate to another page while uploading the new software, or the software upload will be aborted. When the process is complete the access point will restart and resume normal operation.

[Upgrade](#)

عاوناً لمعت ال .tar. فلم رفوت مل اة تباثل اجمار بل اة قرت فلم نو ك ي نأ ب جي :ة ط ح ا ل م
ت ا ف ل ل م ل ا ت ا ق ي س ن ت ن م ي ر خ ا .

TFTP م داخ ل IPv4 ن ا و ن ع ل ق ح ي ف TFTP م داخ ب ص ا خ ال IP ن ا و ن ع ل خ د ا . 2 ة و ط خ ال .

Manage Firmware

PID VID: WAP371-A-K9 V01

Active Firmware Version: 1.0.0.10

Inactive Firmware Version: 1.0.1.5 [Swap Active Image](#)

Transfer Method: HTTP/HTTPS
 TFTP

Source File Name: (Range: 1 - 128 Characters)

TFTP Server IPv4 Address: (xxx.xxx.xxx.xxx)

Note: Uploading the new software may take several minutes. Please do not refresh the page or navigate to another page while uploading the new software, or the software upload will be aborted. When the process is complete the access point will restart and resume normal operation.

[Upgrade](#)

دي د ج ل ا ت با ث ل ا ج م ا ن ر ب ل ا ق ي ب ط ت ل ة ق ر ت ق و ف ر ق ن ا . 3 ة و ط خ ال .

Manage Firmware

PID VID: WAP371-A-K9 V01

Active Firmware Version: 1.0.0.10

Inactive Firmware Version: 1.0.1.5 [Swap Active Image](#)

Transfer Method: HTTP/HTTPS
 TFTP


Source File Name: (Range: 1 - 128 Characters)

TFTP Server IPv4 Address: (xxx.xxx.xxx.xxx)


Note: Uploading the new software may take several minutes. Please do not refresh the page or navigate to another page while uploading the new software, or the software upload will be aborted. When the process is complete the access point will restart and resume normal operation.

[Upgrade](#)

ة ع ب ا ت م ل ل " ق ف ا و م ق و ف ر ق ن ا . دي ك ا ت ة ذ ف ا ن ر ه ط ت . 4 ة و ط خ ال .

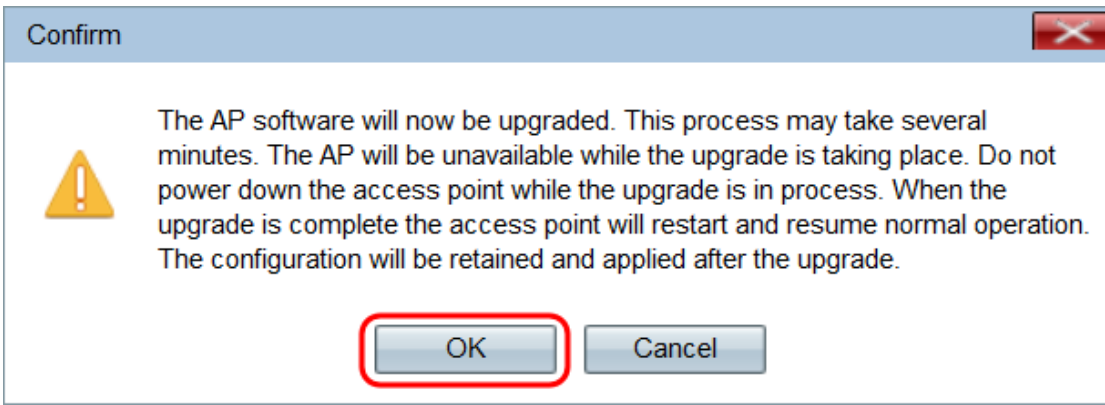

مدمقتال دي قة قرتال ةحفص رهظت:

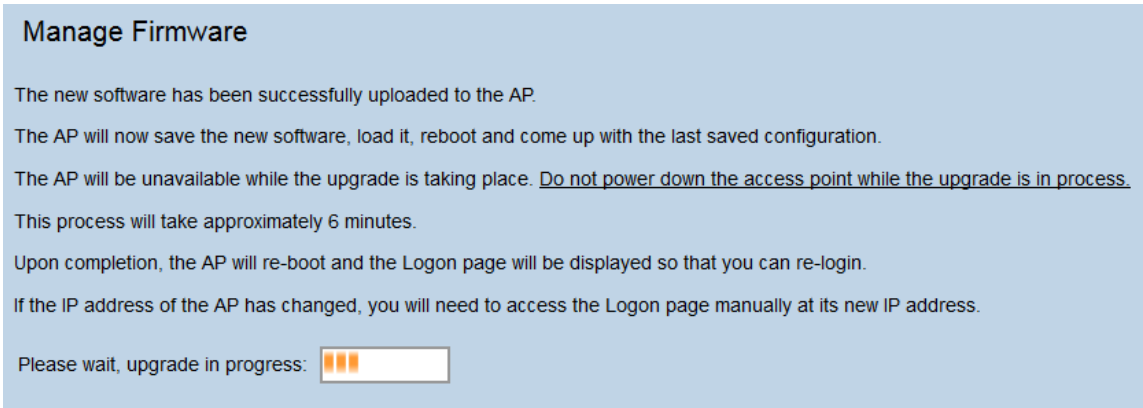

ةلملعل لم تكت يتح شي دحتال مدع اءرل. قئاقد عضب ة قرتال قرغتست: **ةظالم** دق. ةداعال ةلملعل فئاتست و ديهمتال لوصول ةطقن دعت، ةلملعل امامت اءرجمبو. زاهال ة قرت ءانثا تقؤم لكشب لاصلال رايتال اب نيلصلتمال ءالمعل ءيمج دقف ي رهظت مل اذا. ة قرتال لامتك اءب اي ودي ةحفصلال شي دحت ي ل اءاتحتس، ءني عم تال اء ي فب. وي ضرعتسم شي دحتب مقف، قئاقد 6 دعب لوخدل لءجست ةحفص

ةمچرتل هذه لوج

ةللأل تاي نقتل نمة ومة مادختساب دن تسمل اذة Cisco تمةرت
ملاعلاء انء مء مء نمة دختسمل معد ىوتحم مء دقتل ةر شبل او
امك ةق قء نوك ت نل ةللأل ةمچرت لصف أن ةظحال مء ءرء. ةصاأل مء تغلب
Cisco ةلخت. فرتم مچرت مء دقء ةل ةل ةفارتحال ةمچرتل عم لاعل او
ىل إلمءاد ءوچرلاب ةصوء و تاملرتل هذه ةقء نء اهءل وئس م Cisco
Systems (رفوتم طبارل) ةلصلأل ةزىل ءنل دن تسمل